



AN31.19-P-8080-05T	Retrofit trailer coupling control unit	Model 211.004/006/007/008/016/020/ 022/023/026 /028/029/041/042/ 054/056/061/065/070/072/080/ 082/083/084/087/089/090/092	
--------------------	--	--	--

**i** On vehicles with parktronic system (PTS) code 220, with tire pressure monitor (Beru) code 475, with COMAND APS (with navigation) code 527, with TV tuner code 860, with Keyless Go code 889, the bracket (24) is already present and does not have to be replaced by a new one.

- 1 Remove M6 nut (26) from bracket for rear SAM control unit with fuse and relay module (N10/2).
- 2 Position bracket (24) on body bolts provided and mount using M6 nut (26) and a new M6 nut (25).
- 3 Position trailer connection unit [AAG] control unit (N28/1) on bracket (24) and secure using an M6 nut (25).

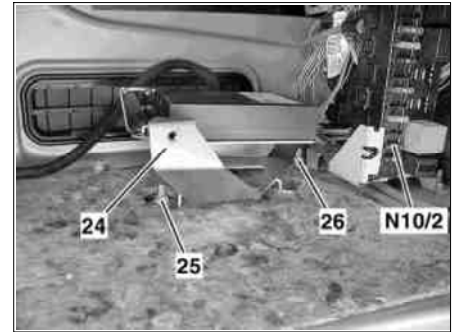

P31.10-2523-01

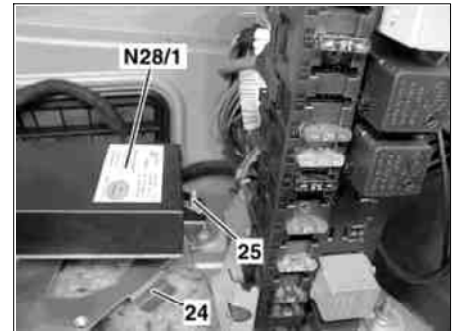

P31.10-2524-01